HS-421 Accelerometer

4-20mA velocity and AC acceleration output via 3 Pin MS Connector

Key Features


- Unique output
- For use with PLC/DCS systems and data collectors
- · Customisable features

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



>108 Ohms at 500 Volts

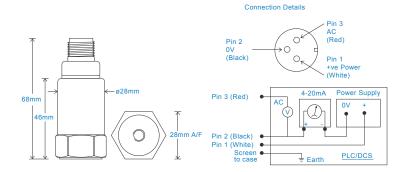

Technical Performance

Mounted Base Resonance 5kHz min

Velocity Ranges see: 'How To Order' table ±10%

Nominal 80Hz at 22°C

Frequency Response 10Hz (600cpm) to 1kHz (60kcpm) ± 5% - ISO10816

Isolation Base isolated

Range see: 'How To Order' table

Transverse Sensitivity Less than 5%

Mechanical

Case Material Stainless Steel
Sensing Element/Construction PZT/Compression
Mounting Torque 8Nm
Weight 150gms (nominal)
Screened Cable Assembly see: www.hansfordsensors.com for options
Connector HS-AA005 - non-booted
HS-AA068 or HS-0069 - booted
Mounting Threads see: 'How To Order' table

Electrical

Case Isolation

Outputs

4-20mA DC current proportional to Range and AC acceleration
Bias Voltage

3 Volts DC (nominal)
Supply Voltage

15-30 Volts DC (for 4-20mA)
Settling Time

2 seconds
Output Impedance

Loop Resistance 600 Ohms max. at 24 Volts

Environmental


 Operating Temperature Range
 -25 to 90°C

 Sealing
 IP68

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013

Typical Frequency Response

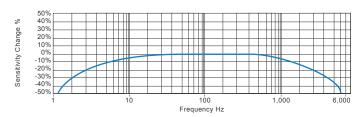


Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



How To Order

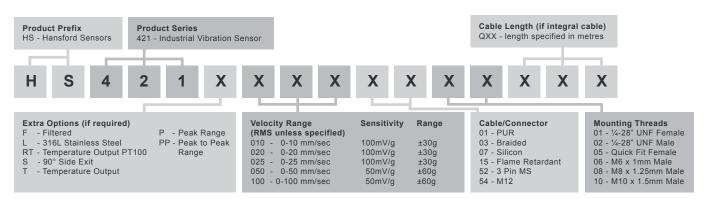



www.hansfordsensors.com sales@hansfordsensors.com



